
IO-Link Sensor

SEH-AB-1/4GA-LI6D-SC


Pressure sensor with display

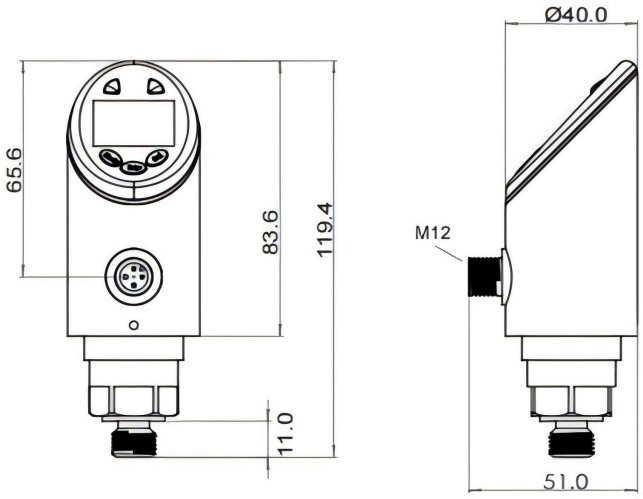

- IO-Link Smart Pressure Sensor
- 4-digit large digital tube display, mirroring, semi-transparent design
- The upper part of the housing can be rotated 300°
- Normally open/normally closed,PNP/NPN/push-pull,hysteresis/window configurable
- Switching signal/analog signal,switching signal/IO-Link can be set
- The display panel adopts an integrated housing
- The main body of the housing is made of stainless steel
- The interface is M12 A code 4-pin
- Key lock function, simple key menu operation
- Sensor parameters can be set via buttons and IO-Link
- The starting and ending points of the analog signal can be set

Model	SEH-AB-1/4GA-LI6D-SC
Operating voltage	24VDC ± 10%
Operating current	< 100mA
Pressure parameters	
Measuring range	-1-1 bar (-0.1-0.1Mpa)
Max overvoltage	2 bar
Interface type	M12 A code 4-pin
Accuracy	0.5%
Output Parameters	
OUT1 Signal	Switching signal or IO-Link (automatic wake-up)
OUT2 Signal	Switching signal or 4-20mA or 20-4mA
Switching signal output type	NPN/PNP/Push-PUll, NO/NC, Hysteresis/Window programmable
Switching signal output current	250mA
Switch point SP setting range	-0.99 bar-1 bar
Release point rP setting range	-1 bar-0.99 bar
Minimum interval between SP and rP points	0.01 bar (0.5%F.S*)
Switching signal output resolution	0.001 bar
Analog signal output maximum load	500Ω
Analog signal output accuracy	0.5%F.S
Minimum interval between analog signal start and end points	0.4 bar (20%F.S)
IO-Link	
Vendor ID	1317 (0x0525)
Device ID	198673 (0x030811)
Number of interfaces	1
IO-Link protocol version	V1.1
IO-Link input bytes	2 bytes (16Bit)
Frame type	TYPE_2_2
Transmission rate	COM2 38.4kbit/s
Minimum cycle time	2400 us
ISDU(Indexing Service)	Support
Block parameter operations	Not support
Data storage(DS)	Not support
Operating temperature	-40-80℃
Protection class	IP65


IO-Link M12 interface



1 = +24VDC
2 = OUT2
3 = 0V
4 = OUT1(C/Q)

Note: OUT1: switching signal or IO-Link
OUT2: switching signal or analog signal

Wiring diagram

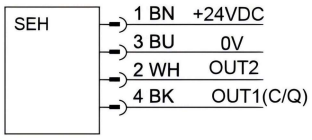

*F.S:Measuring range full scale (e.g. measuring range -1-6bar, then F.S=7)